

Servo amplifier

mcDSA-E50-HC

Article number: 1513860

 Certification: 


Picture similar

Technical data

Supply voltages	
Electronic supply voltage U_e^{*2}	9..30 V
Electronic current consumption @ $U_e=24V^{*3}$	typ. 40 mA
Power supply voltage U_p^{*4}	9..60 V
Output current	
Max. output current	25 A
Continuous output current (certified UL) ^{*5}	
@ $U_p \leq 24V$	9.5 A
@ $U_p \leq 60V$	9 A
Continuous output current (not certified) ^{*6}	
@ $U_p \leq 24V$	14.5 A
@ $U_p \leq 48V$	14.5 A
PWM	
Output voltage	90% U_p
PWM frequency	25, 32 ^{*7} , 50 kHz
Mechanical	
Size LxWxH	87 x 74 x 29 mm
Weight	150 g
Environment	
Protection class	IP20
Ambient temperature (operation) (certified UL)	-40..40 °C
Ambient temperature (operation) (not certified)	-40..70 °C
Ambient temperature (storage)	-40..85 °C
Rel. humidity (non-condensing)	5..90 %
CAN bus	
Protocol	DS301
Device profile	DS402
Max. baudrate	1 Mbit/s
CAN specification	2.0B
Galvanically isolated	no

Sensor supply (Encoder/Hall)	
Output voltage	5 V
Max. output current	0.2 A
Incremental encoder	
Type	incremental
Signals	A,B,Inx
Max. frequency (per channel)	100 kHz
Input voltage	0..5 V
Signal type	open collector, single ended
Hall sensors	
Signals	H1,H2,H3
Max. frequency (per channel)	10 kHz
Input voltage	0..5 V
Signal type	open collector, single ended
Digital inputs	
Number - digital inputs	8 (Din0..7)
Low voltage	0..5 V
High voltage	8..30 V
Digital outputs	
Number	4 (Dout0..3)
Continuous output current (certified UL)	0.3 A
Continuous output current (not certified)	0.3 A
Load Dout0..2	resistive, low inductive
Load Dout3	resistive, inductive
Output voltage	Electronic supply voltage U_e
Signal type	positive switching
Analog inputs	
Number	3 (Ain0..2)
Signal type - Ain0..1	0..10 V, 12 Bit, single ended
Signal type - Ain2 / PT1000	0..5 V, 12 Bit, single ended / PT1000

*1 The certified performance data must be observed (see UL Instruction Note)

*2 No reverse polarity protection, the destruction limit is at overvoltage of $\geq 33V$ or short-term peak voltage of $37V < 1s$

*3 power amplifier switched off, 5V output (sensor supply) is free

*4 No reverse polarity protection, the destruction limit is at overvoltage of $\geq 80V$

*5 connector cable with max. possible cable cross-section, PWM frequency 32 kHz, ambient temperature 40 °C, I/O's and 5V output active, RMS current: 9.5 A \rightarrow 7.8 Aeff, 9 A \rightarrow 7.3 Aeff

*6 connector cable with max. possible cable cross-section, PWM frequency 32 kHz (asymmetrical), ambient temperature 40 °C, I/O's and 5V output free, RMS current: 14.5 A \rightarrow 11.8 Aeff

no guarantee, since value is determined empirical, please consider the application notes to determine the continuous current

*7 default value

Additional technical data are available in mcManual.



miControl® GmbH


Chausseestraße 34

14979 Großbeeren (bei Berlin)

 Copyright 2024 by miControl® - Modifications and errors excepted
 mcDSA-E50-HC - PV1.13.00.00 / DV1.00.00.06

Web: www.miControl.de e-mail: info@miControl.de Tel.: +49 (3379) 312 59-0 Fax: +49 (3379) 312 59-19

Scheme

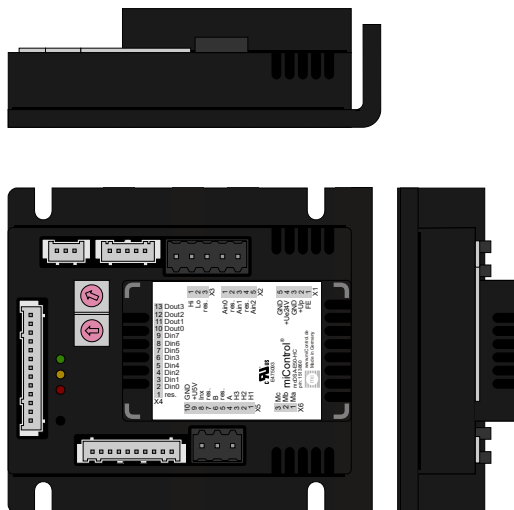

©2023 by miControl

Terminal assignment

X1 Supply		
1	FE	Functional earth
2	+Up	Power supply voltage
3	GND	Ground for power supply voltage
4	+Ue24V	Electronic supply voltage
5	GND	Ground for electronic supply voltage
X2 Analog inputs		
1	Ain0	Analog input 0
2	res.	Reserved
3	Ain1	Analog input 1
4	res.	Reserved
5	Ain2	Analog Input 2 (5V) / PT1000
X3 CAN bus		
1	CAN Hi	CAN High
2	CAN Lo	CAN Low
3	res.	Reserved
X4 Digital inputs/outputs		
1	res.	Reserved
2	Din0	Digital input 0
3	Din1	Digital input 1
4	Din2	Digital input 2
5	Din3	Digital input 3
6	Din4	Digital input 4
7	Din5	Digital input 5
8	Din6	Digital input 6
9	Din7	Digital input 7
10	Dout0	Digital output 0
11	Dout1	Digital output 1
12	Dout2	Digital output 2
13	Dout3	Digital output 3

X5 Hall and inc. encoder			
1	H1	Hall sensor 1	
2	H2	Hall sensor 2	
3	H3	Hall sensor 3	
4	A	Inc. encoder, A channel	
5	res.	Reserved	
6	B	Inc. encoder, B channel	
7	res.	Reserved	
8	Inx	Inc. encoder, index channel	
9	+U5V	5V output voltage for sensor supply Sensors: encoder, hall	
10	GND	Ground for sensor supply Notice: don't connect with system GND	
X6 Motor			
1	Ma	Motor phase A	
2	Mb	Motor phase B	
3	Mc	Motor phase C	